January 20, 2026

E-mail: MMoral23@calstatela.edu

Mr. Mike Morales
Risk Management
Environmental Health & Safety
**California State University Los Angeles (CSULA)**
5151 State University Dr.
Los Angeles, CA 90032

Re: Asbestos Ambient Air Testing
**King Hall**
**Basement – 5th Floor**
5151 State University Dr.
Los Angeles, CA 90032

GETC Project №.: **E226-024**

Dear Mr. Morales:

Global Environmental Training & Consulting (GETC) performed ambient air testing for asbestos for the above referenced property at your request. Samples were taken to determine ambient exposure levels within King Hall – Basement – 5th Floor.

Ambient Air Samples were collected from several areas throughout King Hall (See diagram for locations). All samples were analyzed using Transmission Electron Microscopy (TEM) using the Asbestos Hazard Emergency Response Act (AHERA) Method which determines specific asbestos structure concentration. A total of twenty-one (21) ambient air samples were taken throughout the building. Twenty (20) air samples concluded No Asbestos Structures Detected. Only one (1) air sample from the Besement identified one (1) structure. The air sample is below the EPA Clearance Criteria of ≤70 structures/millimeter squared (s/mm²). Building is approved for occupancy.

Thank you for choosing GETC as the consultant for this project. If you have any questions, please do not hesitate to contact our office at (626) 962-4436.

Respectfully submitted,
Global Environmental Training & Consulting, Inc.

Mario Virgen
President, CAC

# Air / Sampling / Results

| SAMPLE № | ACTIVITY CODE | DESCRIPTION / LOCATION | TYPE OF ASBESTOS |
|---|---|---|---|
| A-01 | TEM | Basement – B Wing | NSD |
| A-02 | TEM | Basement – C Wing | NSD |
| **A-03** | **TEM** | **Basement – C Wing** | **ONE (1) CHRYSOTILE STRUCTURE** |
| A-04 | TEM | Basement – D Wing | NSD |
| A-05 | TEM | 5th Floor – B Wing | NSD |
| A-06 | TEM | 5th Floor – C Wing | NSD |
| A-07 | TEM | 4th Floor – B Wing | NSD |
| A-08 | TEM | 4th Floor – C Wing | NSD |
| A-09 | TEM | 4th Floor – D Wing | NSD |
| A-10 | TEM | 3rd Floor – B Wing | NSD |
| A-11 | TEM | 3rd Floor – C Wing | NSD |
| A-12 | TEM | 3rd Floor – D Wing | NSD |
| A-13 | TEM | 3rd Floor – A Wing | NSD |
| A-14 | TEM | 1st Floor – D Wing | NSD |
| A-15 | TEM | 1st Floor – B Wing | NSD |
| A-16 | TEM | 1st Floor – C Wing | NSD |
| A-17 | TEM | 1st Floor – Suite 1064 | NSD |
| A-18 | TEM | 2nd Floor – C Wing | NSD |
| A-19 | TEM | 2nd Floor – B Wing | NSD |
| A-20 | TEM | 2nd Floor – D Wing | NSD |
| A-21 | TEM | 2nd Floor – A Wing | NSD |
| A-22 | FB | Field Blank | NSD |

**NOTES:** **NSD = NO STRUCTURES DETECTED**


Copyright © 2026 Global Environmental Training & Consulting, Inc. All Rights Reserved

# SAMPLING TABLE


Copyright © 2026 Global Environmental Training & Consulting, Inc. All Rights Reserved

# CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

004380465

East: (866) 871-1984
Central: (800) 651-4802
West: (866) 888-6653

931 Corporate Center Dr.
Pomona, CA 91768



## CONTACT INFORMATION

| | | | |
|---|---|---|---|
| Company: | Global Environmental Training & Consulting | Address: | 1520 W. Cameron Ave Suite 103 West Covina, CA 91790 |
| Contact: | Mario Virgen / Miguel Virgen | Special Instructions: | EMAIL RESULTS TO: STAFF@GLOBALENVIROTRAINING.COM, MARIO.VIRGEN@GLOBALENVIROTRAINING.COM, MIGUEL.VIRGENGLOBALENVIROTRAINING.COM |
| Phone: | 626-962-4436 | | |

## PROJECT INFORMATION

| | | | |
|---|---|---|---|
| Project ID: | E226-024 | | |
| Project Description: | KING HALL | | |
| Project Zip Code: | 90032 | Sampling Date & Time: | 01/17/26 0515 |
| PO Number: | | Sampled By: | Sergio Perez Rashad Perez |

## TURN AROUND TIME CODES (TAT)

**STD** – Standard (DEFAULT)

**ND** – Next Business Day

**SD** – Same Business Day Rush*

*Please call Client Services for locations with Rush services

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

| Sample ID | Description | Sample Type (Below) | TAT (Above) | Total Volume (Air Samples only) | Notes |
|---|---|---|---|---|---|
| A-01 | Basement South Hallway | A | SD | 1,287 liters | |
| A-02 | Main | | | | |
| A-03 | East | | | | |
| A-04 | North | | | | |
| A-05 | 5th Floor South | | | | |
| A-06 | East | | | | |
| A-07 | 4th Floor South | | | | |
| A-08 | East | | | | |
| A-09 | North | | | | |
| A-10 | 3rd Floor South | | | | |
| A-11 | East | | | | |

## ASBESTOS ANALYSIS

**REQUESTED SERVICES** (Check boxes below)

| PCM Air | | PLM Bulk | | | | | | PLM Rock & Soil | | Other Requests | | |
|---|---|---|---|---|---|---|---|---|---|---|---|---|
| Fiber Count (NIOSH 7400) | OSHA with TWA | Asbestos Bulk PLM | EPA Point Count (200 Point Count) | EPA Point Count (400 Point Count) | EPA Point Count (1000 Point Count) | Gravimetric Point Count (400 Pt Count) | Gravimetric Point Count (1000 Pt Count) | CARB 435 Method (400 Point Count) | CARB 435 Method (1000 Point Count) | Lead Analysis – Flame AA - LEAD WIPES | Asbestos TEM - AHERA | |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |

| SAMPLE TYPE CODES | | RELINQUISHED BY | DATE & TIME | RECEIVED BY | DATE & TIME |
|---|---|---|---|---|---|
| A – Air | W – Wipe | Sergio Perez | 01/19/26 0715 | AB/AJS | 1.19.26 0800 |
| B – Bulk | T – Tape | Sgio Pz-La | | | |
| D – Dust | R – Rock | | | | |
| SO – Soil | O – Other: | | | | |

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/

Copyright © 2022 Eurofins EPK Built Environment Testing, LLC

# CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

004380465

East: (866) 871-1984
Central: (800) 651-4802
West: (866) 888-6653

931 Corporate Center Dr.
Pomona, CA 91768

2 of 2

## CONTACT INFORMATION

| | | | |
|---|---|---|---|
| Company: | Global Environmental Training & Consulting | Address: | 1520 W. Cameron Ave Suite 103 West Covina, CA 91790 |
| Contact: | Mario Virgen / Miguel Virgen | Special Instructions: | EMAIL RESULTS TO: STAFF@GLOBALENVIROTRAINING.COM, MARIO.VIRGEN@GLOBALENVIROTRAINING.COM, MIGUEL.VIRGENGLOBALENVIROTRAINING.COM |
| Phone: | 626-962-4436 | | |

## PROJECT INFORMATION

| | | | |
|---|---|---|---|
| Project ID: | E226-024 | | |
| Project Description: | KING HALL | | |
| Project Zip Code: | 90032 | Sampling Date & Time: | 01/17/26 0515 |
| PO Number: | | Sampled By: | Sergio Perez Rashad Perez |

## TURN AROUND TIME CODES (TAT)

**STD** – Standard (DEFAULT)

**ND** – Next Business Day

**SD** – Same Business Day Rush*

*Please call Client Services for locations with Rush services

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

| Sample ID | Description | Sample Type (Below) | TAT (Above) | Total Volume (Air Samples only) | Notes |
|---|---|---|---|---|---|
| A-12 | 3rd Floor North Hallway | A | SD | 1,287 liters | |
| A-13 | West | | | | |
| A-14 | 1st Floor North | | | | |
| A-15 | South | | | | |
| A-16 | East | | | | |
| A-17 | Suite 1064 | | | | |
| A-18 | 2nd Floor East Hallway | | | | |
| A-19 | South | | | | |
| A-20 | North | | | | |
| A-21 | West | | | | |
| A-22 | Field Blank | | | | Do Not Analyze blank |

## ASBESTOS ANALYSIS

**REQUESTED SERVICES** (Check boxes below)

| PCM Air | | PLM: Bulk | | | | | | PLM: Rock & Soil | | Other Requests | | |
|---|---|---|---|---|---|---|---|---|---|---|---|---|
| Fiber Count (NIOSH 7400) | OSHA with TWA | Asbestos Bulk PLM | EPA Point Count (200 Point Count) | EPA Point Count (400 Point Count) | EPA Point Count (1000 Point Count) | Gravimetric Point Count (400 Pt Count) | Gravimetric Point Count (1000 Pt Count) | CARB 435 Method (400 Point Count) | CARB 435 Method (1000 Point Count) | Lead Analysis – Flame AA - LEAD WIPES | Asbestos TEM - AHERA | |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☒ | ☐ |
| ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ | ☐ |

| SAMPLE TYPE CODES | | RELINQUISHED BY | DATE & TIME | RECEIVED BY | DATE & TIME |
|---|---|---|---|---|---|
| A – Air | W – Wipe | Sergio Perez | 01/19/26 0715 | HSMS | 1.19.26 0800 |
| B – Bulk | T – Tape | | | | |
| D – Dust | R – Rock | | | | |
| SO – Soil | O – Other: | | | | |

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/

Copyright © 2022 Eurofins EPK Built Environment Testing, LLC

# ANALYTICAL LABORATORY REPORT


Copyright © 2026 Global Environmental Training & Consulting, Inc. All Rights Reserved

eurofins | Built Environment Testing

Report for:

**Mario Virgen**
**Global Environmental Training & Consulting, Inc.**
1520 W. Cameron Ave
Suite 103
West Covina, CA 91790

---

Regarding: Eurofins Built Environment Testing West, LLC
Project: E226-024; KING HALL
EML ID: 4380465

Approved by:



Approved Signatory
Arthur Bucio

Dates of Analysis:
Asbestos TEM - AHERA (40CFR Part 763, Subpart E, Appendix A): 01-19-2026

Service SOPs: Asbestos TEM - AHERA (40CFR Part 763, Subpart E, Appendix A) (EBET-TEM-SOP83945)
NVLAP Lab Code 200757-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. Due to the nature of the analyses performed, field blank correction of results is not applied. The results relate only to the samples as received and tested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

**Eurofins Built Environment Testing West, LLC**
2841 Dow Avenue, Suite 300, Tustin, CA 92780
(833) 465-5857 www.eurofinsus.com/Built

Client: Global Environmental Training & Consulting, Inc.
C/O: Mario Virgen
Re: E226-024; KING HALL

Date of Sampling: 01-17-2026
Date of Receipt: 01-19-2026
Date of Report: 01-19-2026

## ASBESTOS TEM AHERA REPORT

| Lab ID-Version‡<br>Location<br>Analysis Date | Volume (liters) | Area Analyzed (mm2) | Grid Openings Examined | Analytical Sensitivity (S/cm3) | Non-Asbestos Count | Asbestos Types | Asbestos Structures (S) | | §Asbestos Concentration | |
|---|---|---|---|---|---|---|---|---|---|---|
| | | | | | | | >= 5µm | >=0.5-<5µm | S/mm2 | S/cm3 |
| 21957707-1<br>A-01 Basement South Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957708-1<br>A-02 Basement Main Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957709-1<br>A-03 Basement East Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | Chrysotile | 0 | 1 | 15.723 | 0.005 |
| Comments: | | | | | | | | | | |
| 21957710-1<br>A-04 Basement North Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 1 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957711-1<br>A-05 5th Floor South Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957712-1<br>A-06 5th Floor East Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |

§ Asbestos Concentration has been rounded to three significant figures to reflect analytical precision.

The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

Digital images of diffraction patterns and copies of analytical bench sheets pertaining to this project are available upon request. The estimated measurement of uncertainty and 95% confidence interval for the test results are also available upon request.

The laboratory is not responsible for data collected by personnel who are not part of the laboratory. Results reported in both structures/cm3 and structures/mm2 are dependent on the volume of air sampled and measured by non-laboratory personnel.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**
2841 Dow Avenue, Suite 300, Tustin, CA 92780
(833) 465-5857 www.eurofinsus.com/Built

Client: Global Environmental Training & Consulting, Inc.
C/O: Mario Virgen
Re: E226-024; KING HALL

Date of Sampling: 01-17-2026
Date of Receipt: 01-19-2026
Date of Report: 01-19-2026

## ASBESTOS TEM AHERA REPORT

| Lab ID-Version‡<br>Location<br>Analysis Date | Volume (liters) | Area Analyzed (mm2) | Grid Openings Examined | Analytical Sensitivity (S/cm3) | Non-Asbestos Count | Asbestos Types | Asbestos Structures (S) | | §Asbestos Concentration | |
|---|---|---|---|---|---|---|---|---|---|---|
| | | | | | | | >= 5µm | >=0.5-<5µm | S/mm2 | S/cm3 |
| 21957713-1<br>A-07 4th Floor South Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957714-1<br>A-08 4th Floor East Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957715-1<br>A-09 4th Floor North Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957716-1<br>A-10 3rd Floor South Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957717-1<br>A-11 3rd Floor East Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957718-1<br>A-12 3rd Floor North Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |

§ Asbestos Concentration has been rounded to three significant figures to reflect analytical precision.

The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

Digital images of diffraction patterns and copies of analytical bench sheets pertaining to this project are available upon request. The estimated measurement of uncertainty and 95% confidence interval for the test results are also available upon request.

The laboratory is not responsible for data collected by personnel who are not part of the laboratory. Results reported in both structures/cm3 and structures/mm2 are dependent on the volume of air sampled and measured by non-laboratory personnel.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**
2841 Dow Avenue, Suite 300, Tustin, CA 92780
(833) 465-5857 www.eurofinsus.com/Built

Client: Global Environmental Training & Consulting, Inc.
C/O: Mario Virgen
Re: E226-024; KING HALL

Date of Sampling: 01-17-2026
Date of Receipt: 01-19-2026
Date of Report: 01-19-2026

## ASBESTOS TEM AHERA REPORT

| Lab ID-Version‡<br>Location<br>Analysis Date | Volume (liters) | Area Analyzed (mm2) | Grid Openings Examined | Analytical Sensitivity (S/cm3) | Non-Asbestos Count | Asbestos Types | Asbestos Structures (S) | | §Asbestos Concentration | |
|---|---|---|---|---|---|---|---|---|---|---|
| | | | | | | | >= 5µm | >=0.5-<5µm | S/mm2 | S/cm3 |
| 21957719-1<br>A-13 3rd Floor West Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957720-1<br>A-14 1st Floor North Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957721-1<br>A-15 1st Floor South Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957722-1<br>A-16 1st Floor East Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957723-1<br>A-17 1st Floor Suite 1064<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957724-1<br>A-18 2nd Floor East Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |

§ Asbestos Concentration has been rounded to three significant figures to reflect analytical precision.

The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

Digital images of diffraction patterns and copies of analytical bench sheets pertaining to this project are available upon request. The estimated measurement of uncertainty and 95% confidence interval for the test results are also available upon request.

The laboratory is not responsible for data collected by personnel who are not part of the laboratory. Results reported in both structures/cm3 and structures/mm2 are dependent on the volume of air sampled and measured by non-laboratory personnel.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**
2841 Dow Avenue, Suite 300, Tustin, CA 92780
(833) 465-5857 www.eurofinsus.com/Built

Client: Global Environmental Training & Consulting, Inc.
C/O: Mario Virgen
Re: E226-024; KING HALL

Date of Sampling: 01-17-2026
Date of Receipt: 01-19-2026
Date of Report: 01-19-2026

## ASBESTOS TEM AHERA REPORT

| Lab ID-Version‡<br>Location<br>Analysis Date | Volume (liters) | Area Analyzed (mm2) | Grid Openings Examined | Analytical Sensitivity (S/cm3) | Non-Asbestos Count | Asbestos Types | Asbestos Structures (S) | | §Asbestos Concentration | |
|---|---|---|---|---|---|---|---|---|---|---|
| | | | | | | | >= 5µm | >=0.5-<5µm | S/mm2 | S/cm3 |
| 21957725-1<br>A-19 2nd Floor South Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957726-1<br>A-20 2nd Floor North Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |
| 21957727-1<br>A-21 2nd Floor West Hallway<br>01/19/2026 | 1287 | 0.06 | 6 | 0.005 | 0 | No Structures Detected | 0 | 0 | <15.723 | <0.005 |
| Comments: | | | | | | | | | | |

§ Asbestos Concentration has been rounded to three significant figures to reflect analytical precision.

The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

Digital images of diffraction patterns and copies of analytical bench sheets pertaining to this project are available upon request. The estimated measurement of uncertainty and 95% confidence interval for the test results are also available upon request.

The laboratory is not responsible for data collected by personnel who are not part of the laboratory. Results reported in both structures/cm3 and structures/mm2 are dependent on the volume of air sampled and measured by non-laboratory personnel.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**
2841 Dow Avenue, Suite 300, Tustin, CA 92780
(833) 465-5857 www.eurofinsus.com/Built


Client: Global Environmental Training & Consulting, Inc.
C/O: Mario Virgen
Re: E226-024; KING HALL

Date of Sampling: 01-17-2026
Date of Receipt: 01-19-2026
Date of Report: 01-19-2026


## ASBESTOS TEM AHERA REPORT

## PROJECT ANALYSTS AND SIGNATORY REPORT

**Project Analysts**



**Analyst:** Arthur Bucio

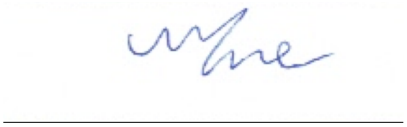


**Analyst:** Yue Wu

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

# SCHEMATIC


Copyright © 2026 Global Environmental Training & Consulting, Inc. All Rights Reserved

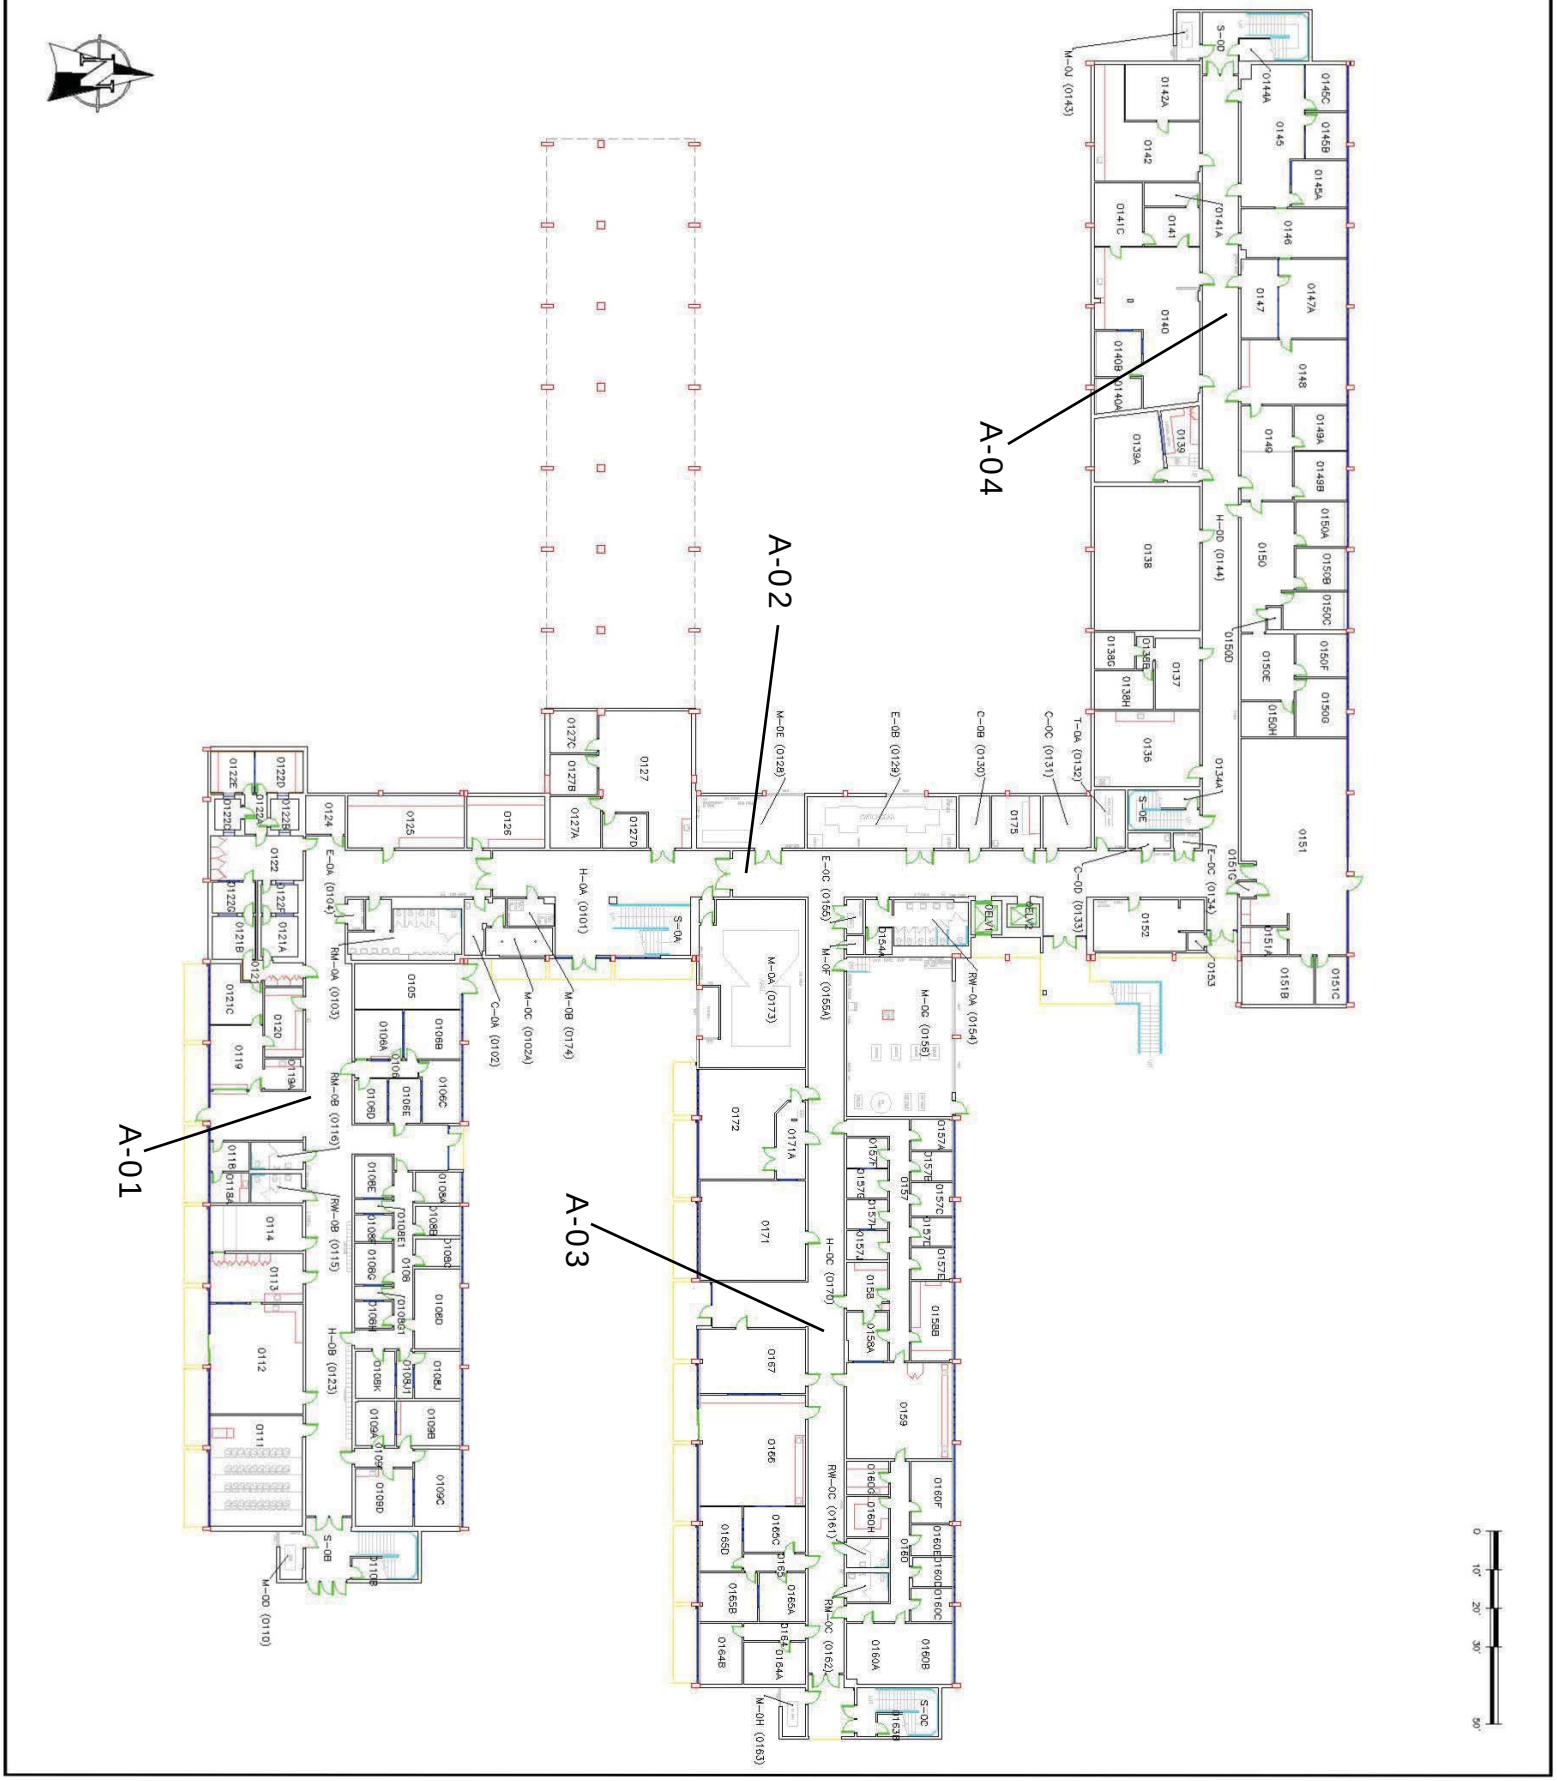



BLDG 3

# MARTIN LUTHER KING HALL
## BASEMENT

LAST UPDATED: 06-22-16

CAL STATE LA
PLANNING, DESIGN & CONSTRUCTION

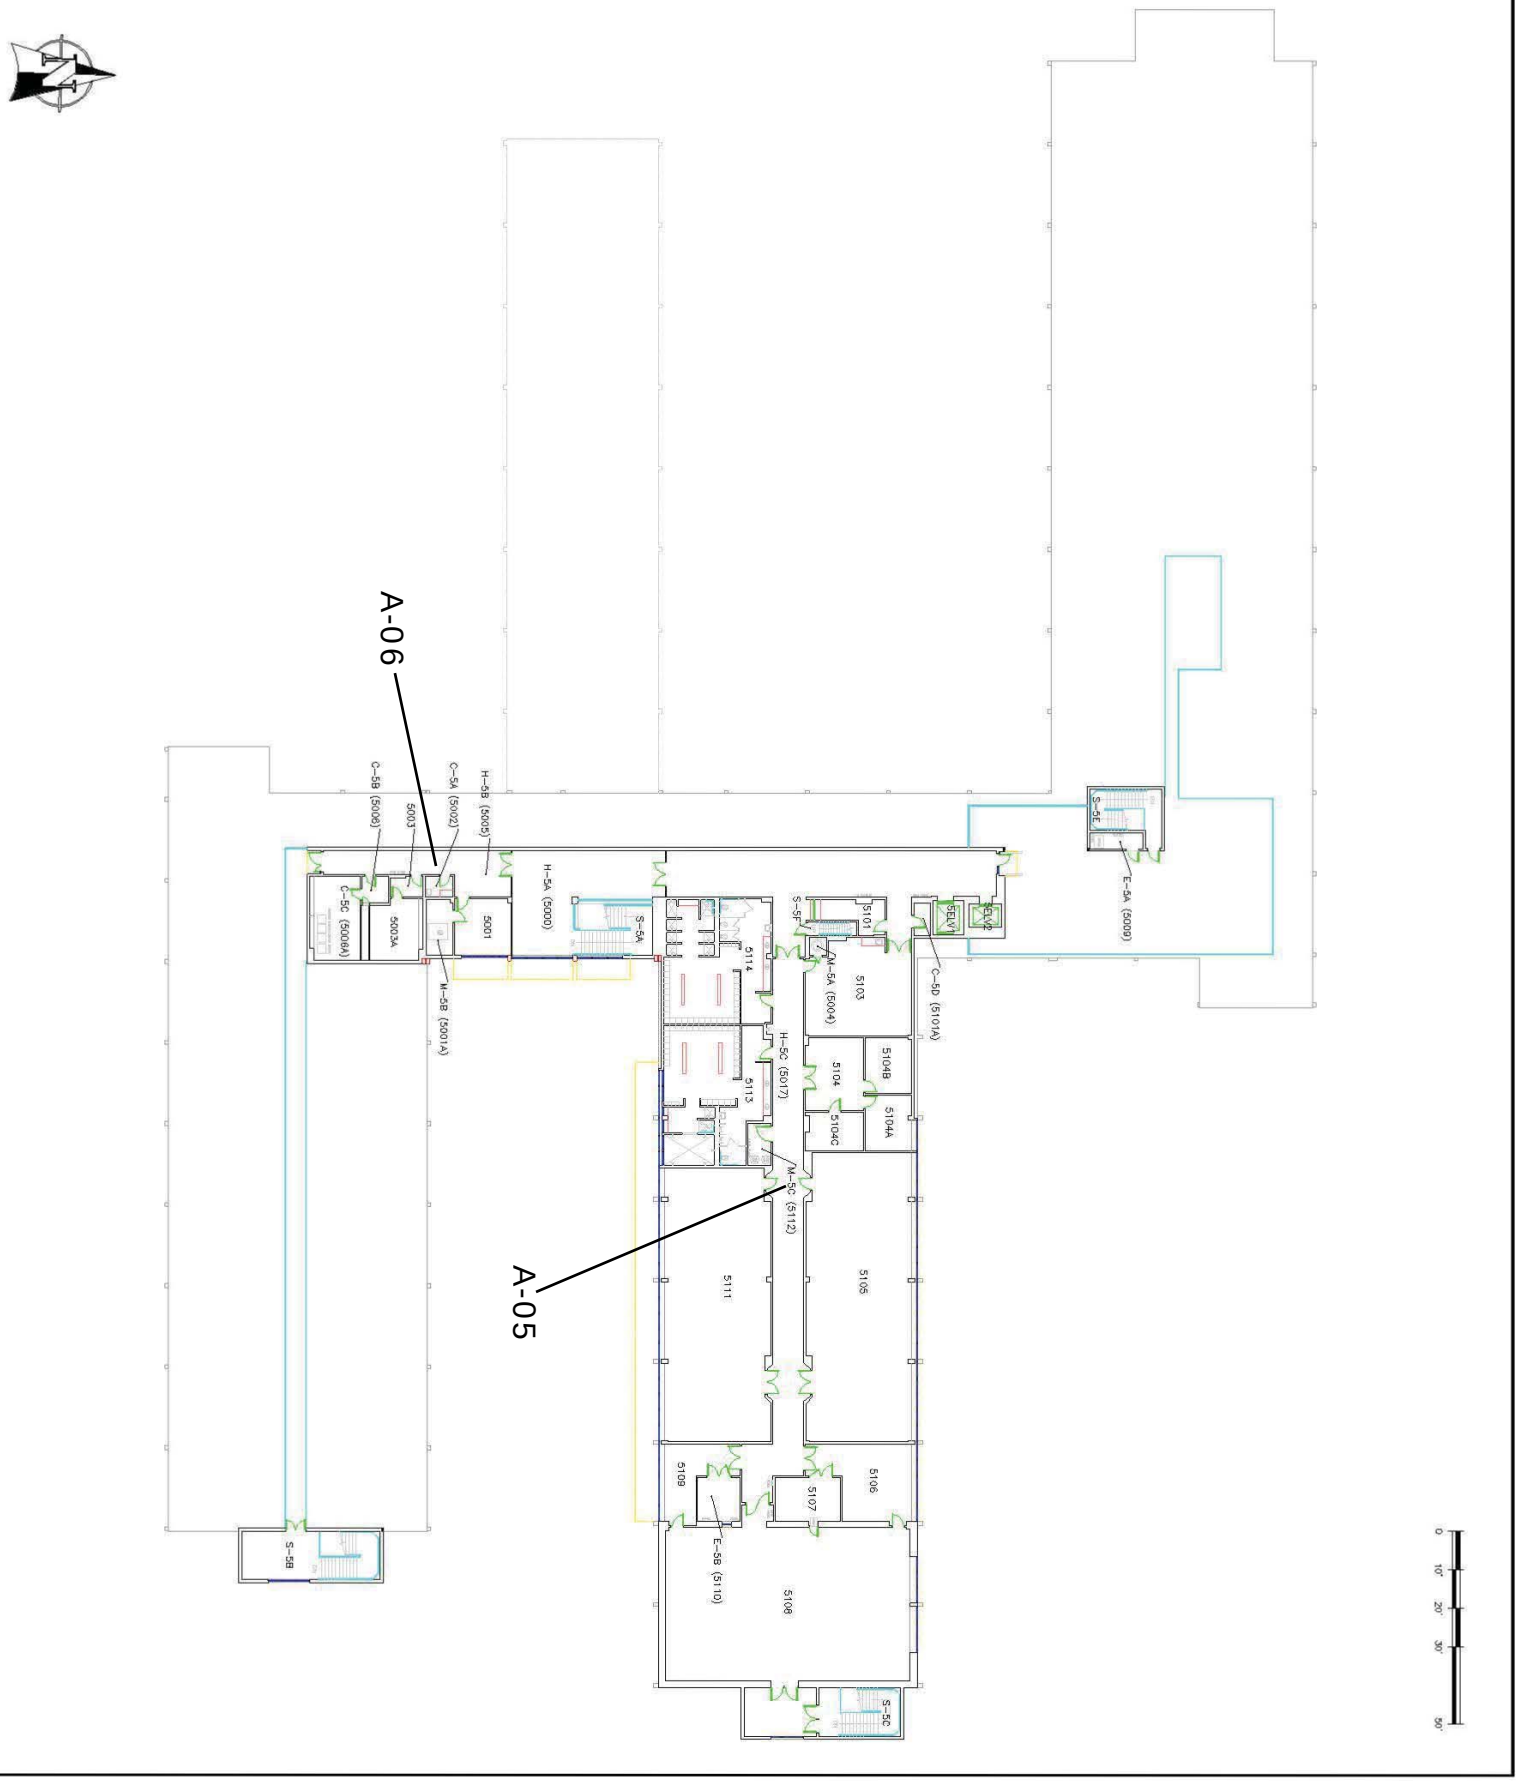


3 BLDG


**MARTIN LUTHER KING HALL**

**FIFTH FLOOR**

LAST UPDATED: 06-22-16

CAL STATE LA

PLANNING, DESIGN & CONSTRUCTION

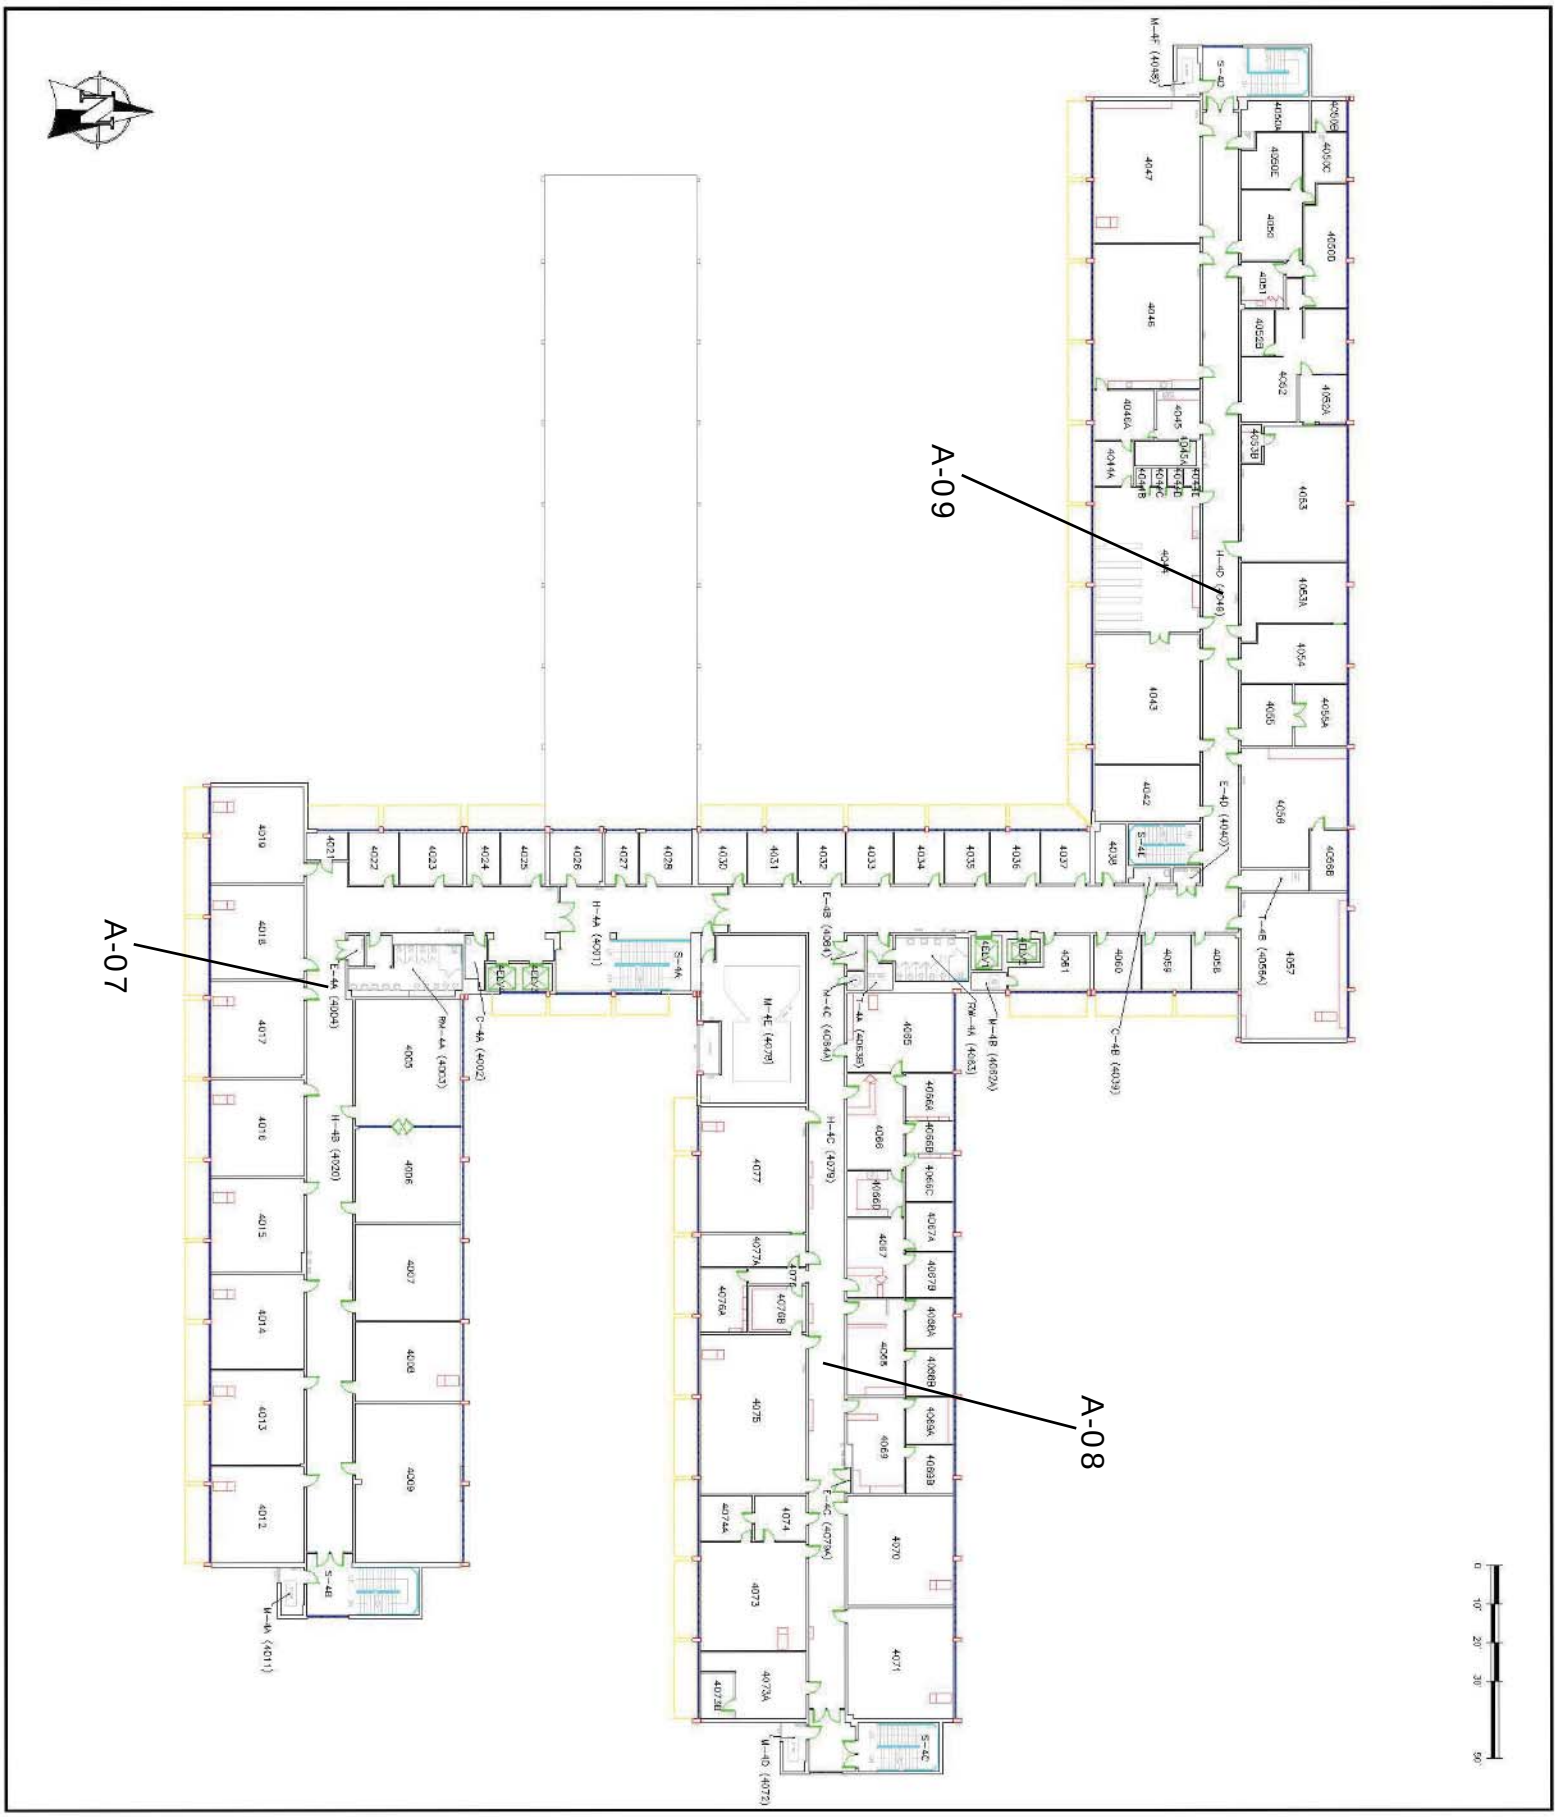



3 BLDG

# MARTIN LUTHER KING HALL
## FOURTH FLOOR

LAST UPDATED: 06-22-16

CAL STATE LA
PLANNING, DESIGN & CONSTRUCTION

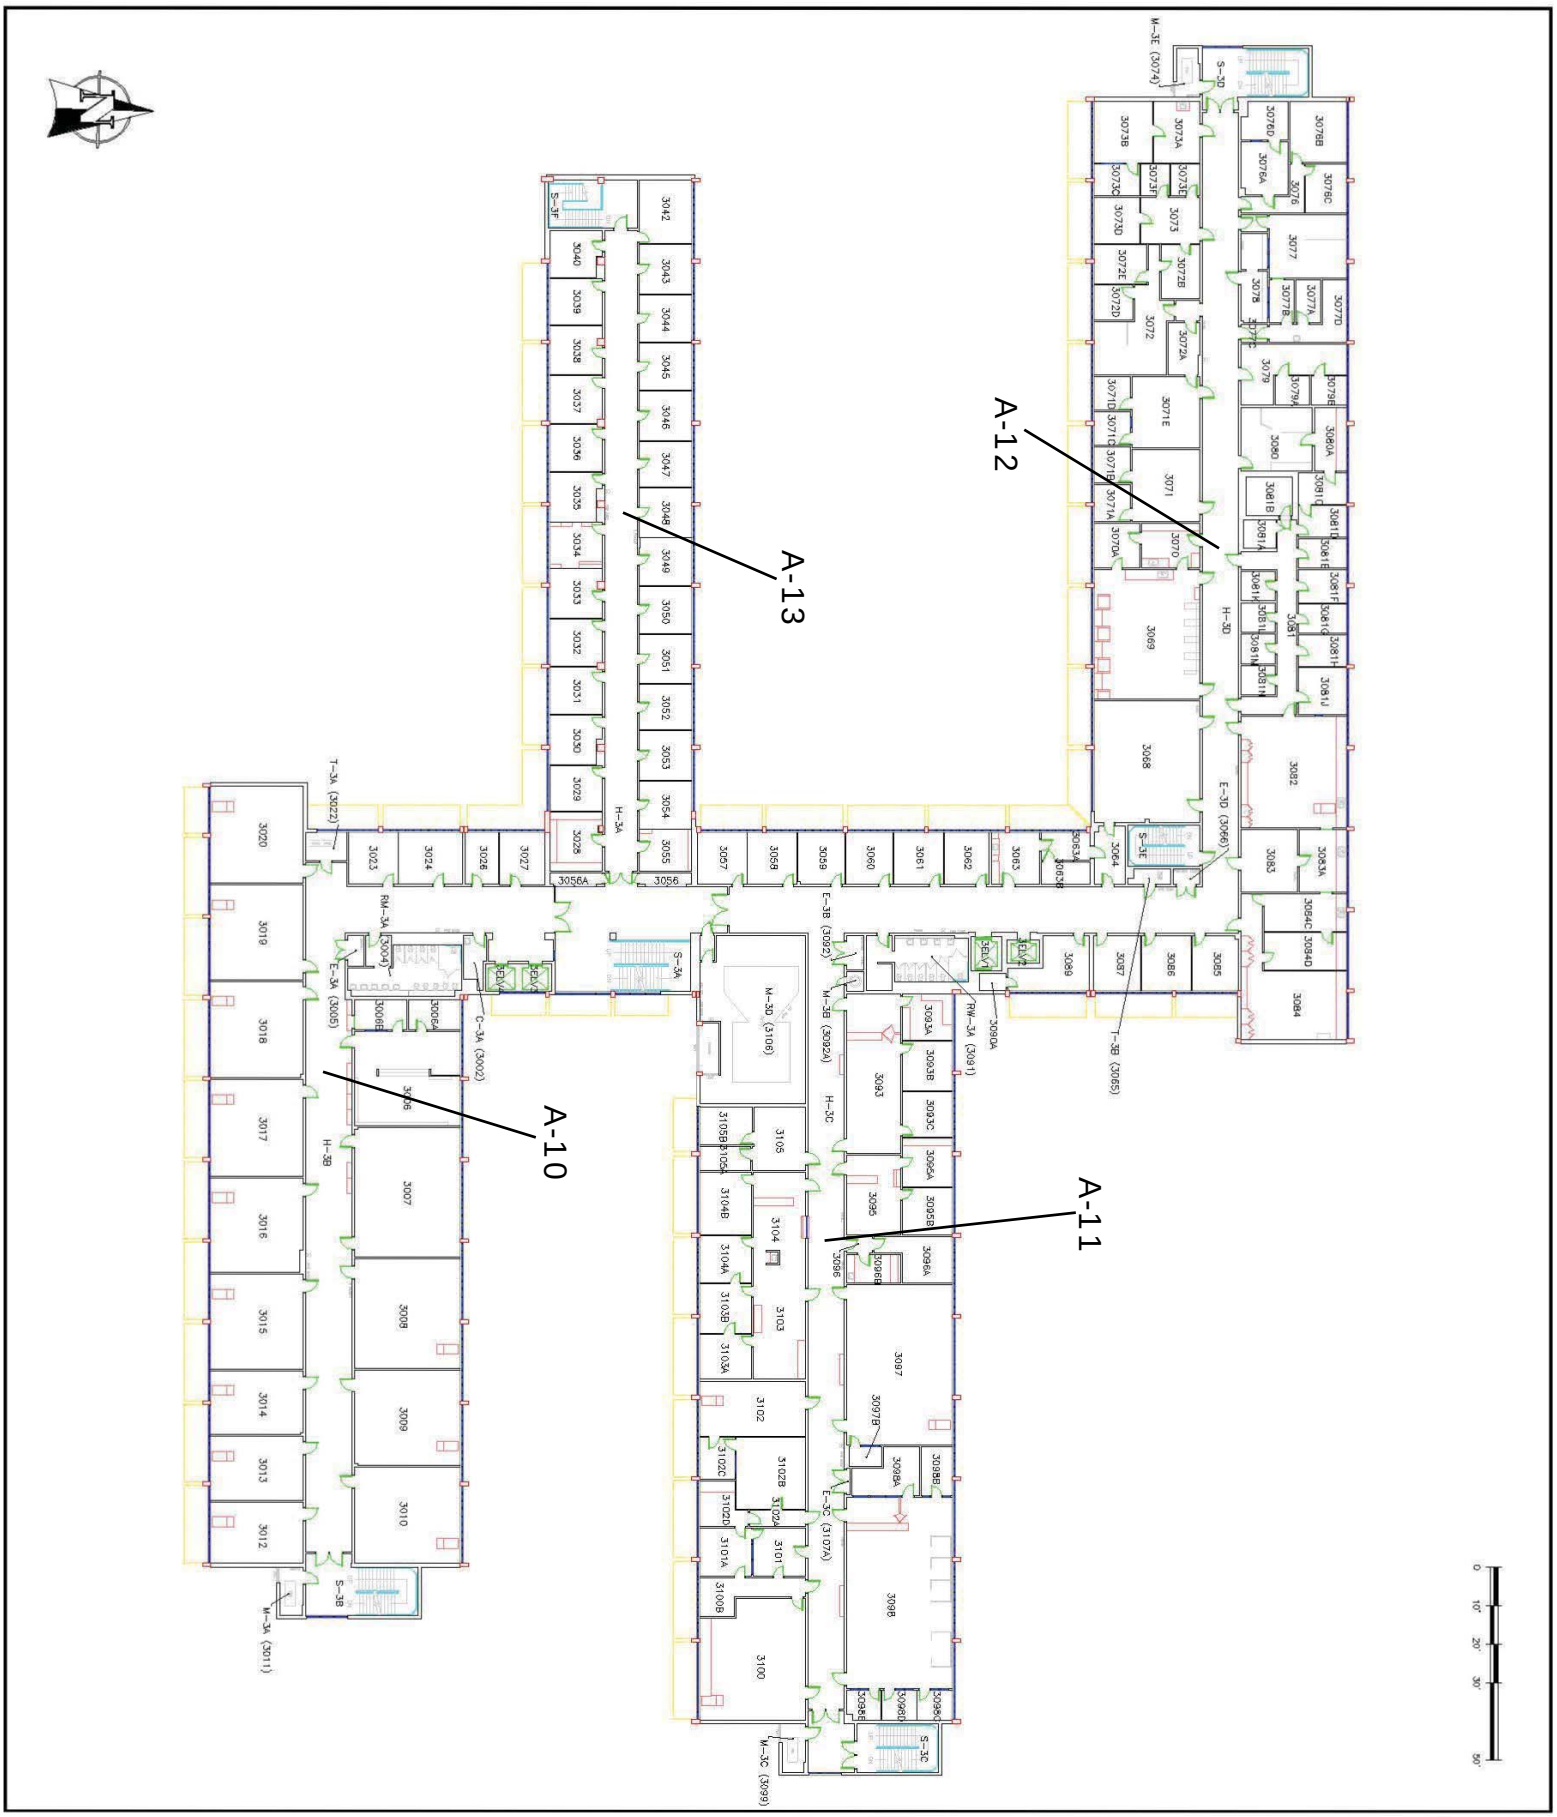



BLDG 3

# MARTIN LUTHER KING HALL
## THIRD FLOOR

LAST UPDATED: 06-22-16

CAL STATE LA
PLANNING, DESIGN & CONSTRUCTION

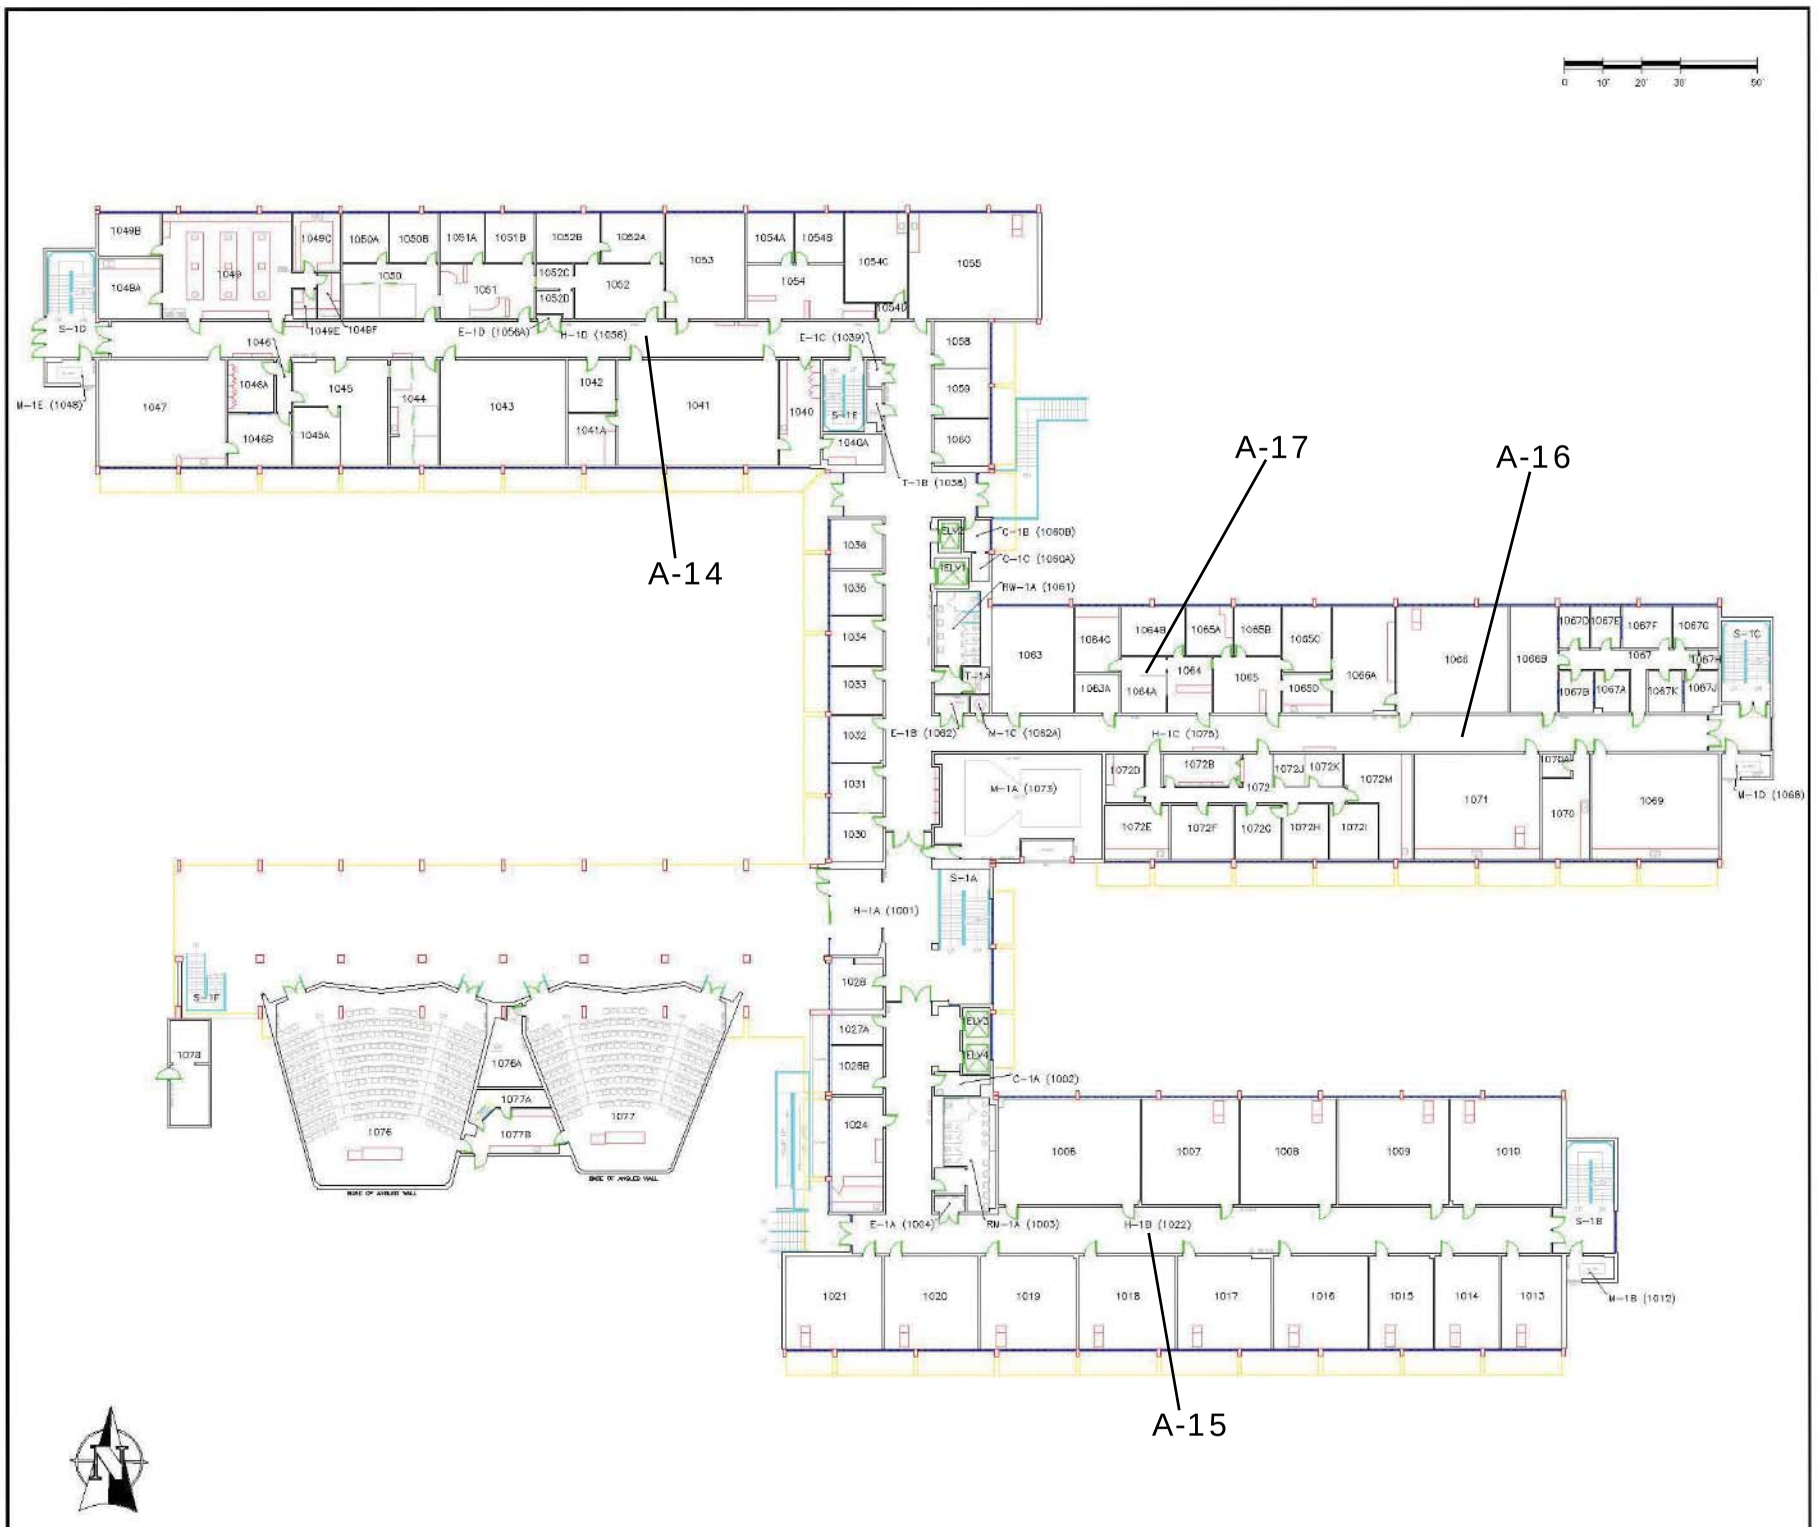



CAL STATE LA
PLANNING, DESIGN & CONSTRUCTION

# MARTIN LUTHER KING HALL
## FIRST FLOOR

LAST UPDATED: 10-04-19

BLDG
3

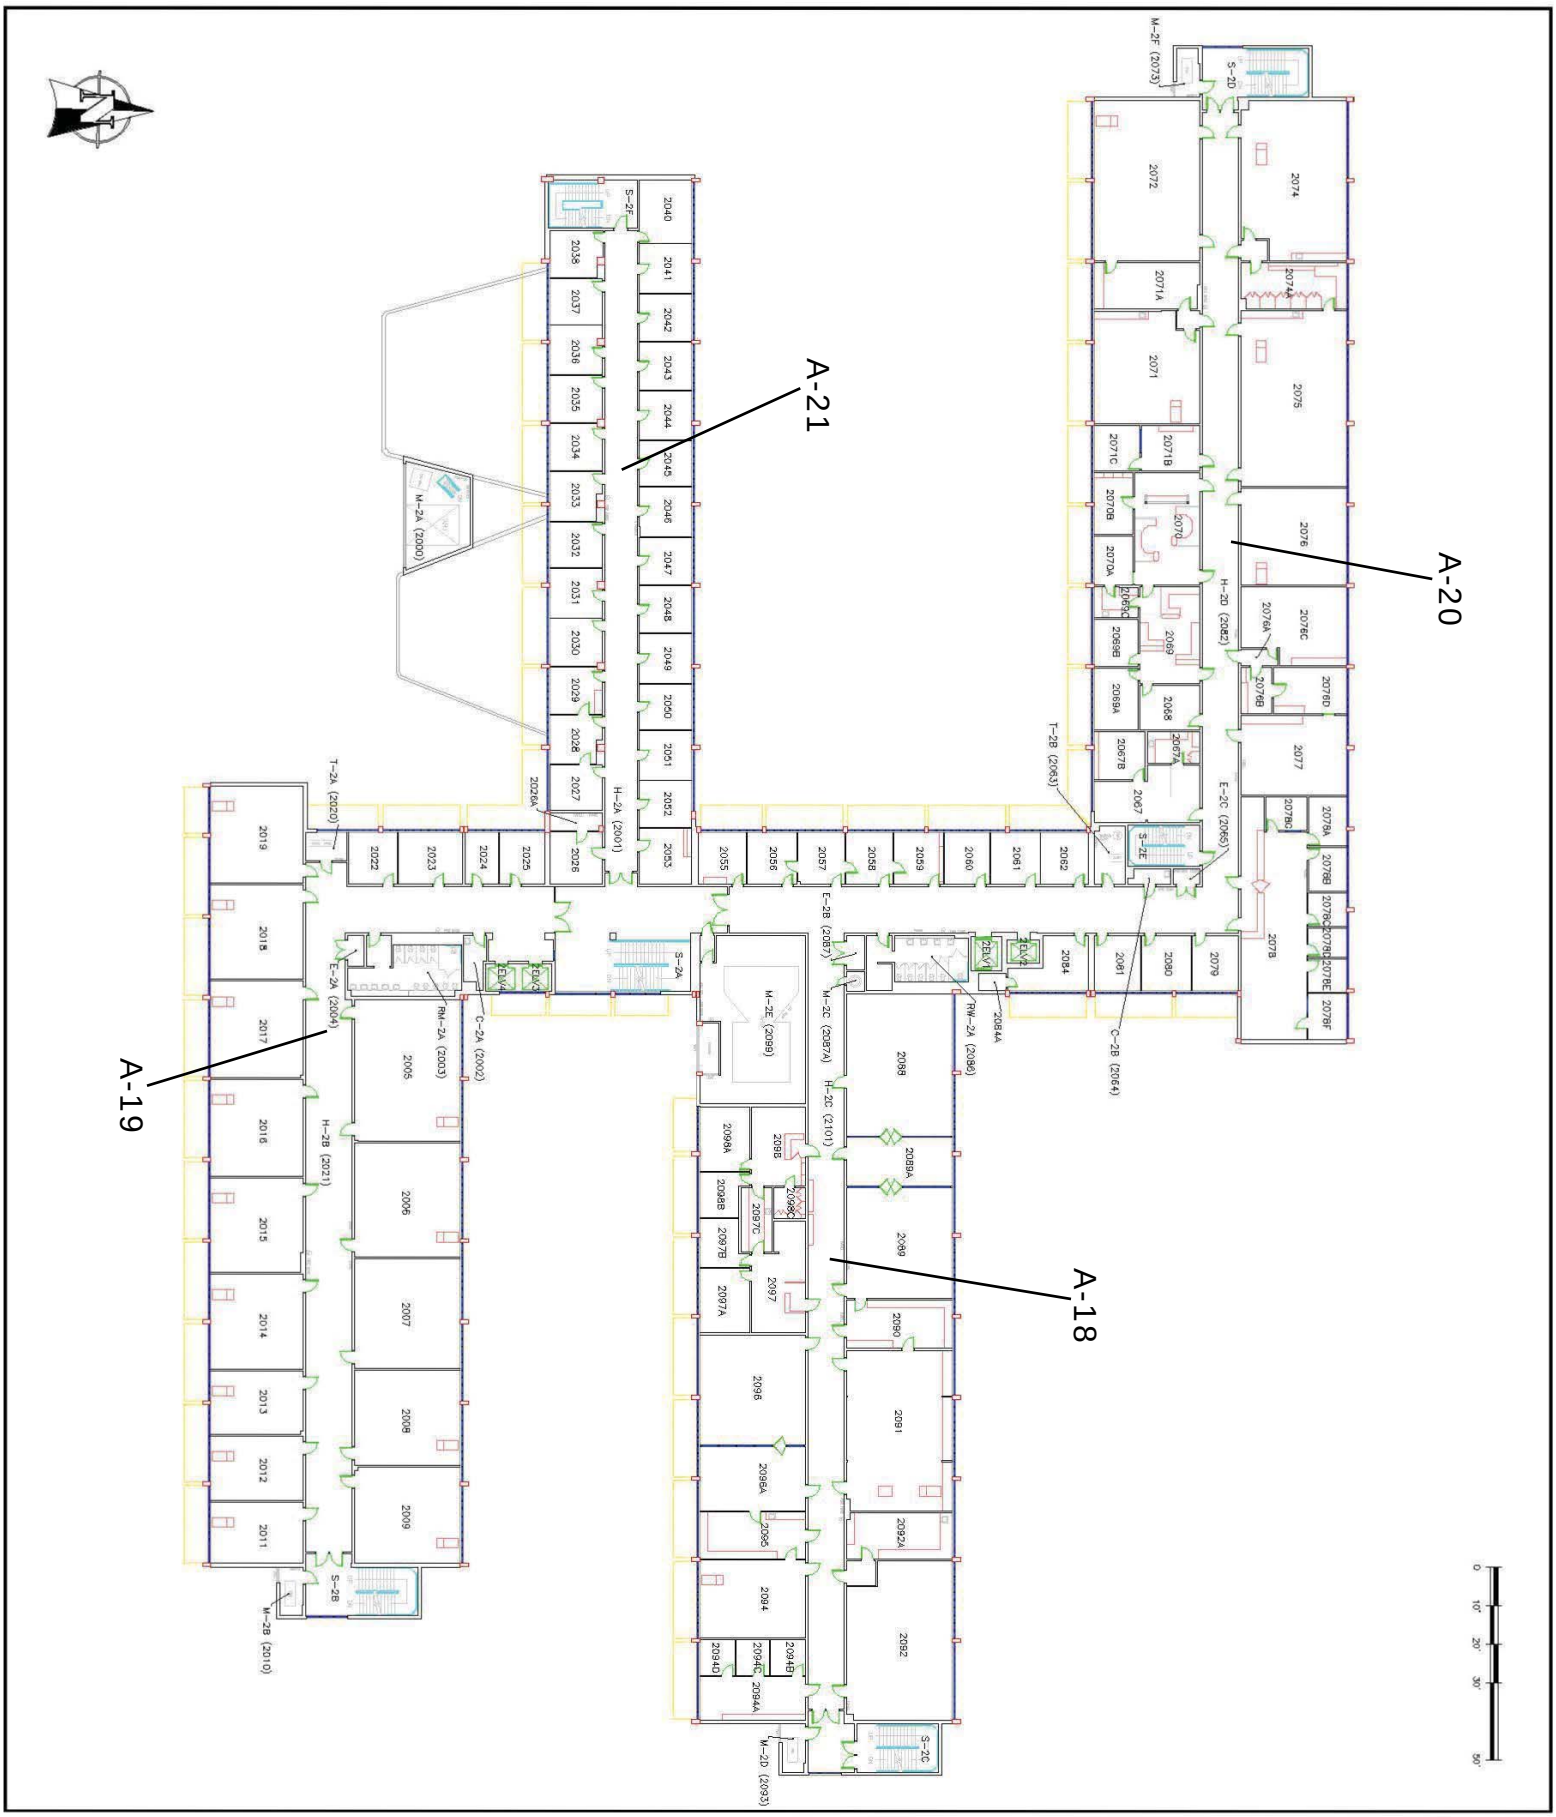


3 BLDG

# MARTIN LUTHER KING HALL
## SECOND FLOOR

LAST UPDATED: 06-22-16

CAL STATE LA
PLANNING, DESIGN & CONSTRUCTION

# INSPECTOR'S CERTIFICATION


Copyright © 2026 Global Environmental Training & Consulting, Inc. All Rights Reserved

State of California
Division of Occupational Safety and Health
**Certified Site Surveillance Technician**

**Sergio R Perez-Loa**

Name



Certification No. **18-6224**

Expires on **05/15/2026**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq of the Business and Professions Code.

State of California
Division of Occupational Safety and Health
**Certified Asbestos Consultant**

**Mario A Virgen**

Name



Certification No. **00-2859**

Expires on **01/05/2027**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq of the Business and Professions Code.