April 29, 2025

Mr. Mike Morales
Risk Management – Environmental Health & Safety
California State University Los Angeles
5151 State University Dr.
Los Angeles, CA 90032

Re: Asbestos Ambient Air Monitoring
California State University Los Angeles
King Hall – 2nd Floor – Rooms: D2078, D2078E, & D2708F
5151 State University Dr.
Los Angeles, CA 90032

GETC Project №.: **E225-125**

Dear Mr. Morales:

Global Environmental Training & Consulting (GETC) performed asbestos ambient air monitoring for the above referenced property at your request. Samples were taken to determine ambient exposure levels within King Hall – 2nd Floor – Rooms: D2078, D2078E, & D2708F.

Ambient Air Samples were collected from several areas throughout King Hall – 2nd Floor – Rooms: D2078, D2078E, & D2708F (See diagram for locations). All samples were analyzed using Transmission Electron Microscopy (TEM) using the National Institute of Occupational Safety and Health (NIOSH) Method 7402 which determines specific asbestos structure concentration. The ambient air sample results indicate that Samples #A-03 & #A-04 have no structures detected. However, one (1) Structure of Chrysotile was detected in Sample #A-02 but is below the Environmental Protection Agency (EPA) Clearance Criteria of 70 structures/millimeter squared (70 s/mm²). Area is approved for re-occupancy.

Thank you for choosing GETC as the consultant for this project. If you have any questions, please do not hesitate to contact our office at (626) 962-4436.

Respectfully submitted,
Global Environmental Training & Consulting, Inc.

Mario Virgen
CAC #00-2859

SAMPLING TABLE

Copyright © 2025 Global Environmental Training & Consulting, Inc. All Rights Reserved

Air / Sampling / Results

SAMPLE №	ACTIVITY CODE	DESCRIPTION / LOCATION	TYPE OF ASBESTOS
T-01	FB	FIELD BLANK	NSD
T-02	TEM	ROOM KH D2078	CHRYSOTILE
T-03	TEM	ROOM KH D2078E	NSD
T-04	TEM	ROOM KH D2078F	NSD

NOTES: **NSD = NO STRUCTURES DETECTED**

Copyright © 2025 Global Environmental Training & Consulting, Inc. All Rights Reserved

ANALYTICAL LABORATORY REPORT

Copyright © 2025 Global Environmental Training & Consulting, Inc. All Rights Reserved

CHAIN OF CUSTODY eurofins

www.eurofinsus.com/Built

Built Environment Testing

004049202

Marlton, NJ: 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 * **(866) 871-1984**
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * **(800) 651-4802**
Burlingame, CA: 111 Anza Blvd, Suite 122, Burlingame, CA 94010 * **(866) 888-6653**

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

CONTACT INFORMATION

Company:	Global Environmental Training & Consulting, Inc. (44626)1520 W. Cameron Ave Suite 103 West Covina, CA 91790	Address:	
Contact:	Mario Virgen		
Phone:	626-962-4436	Special Instructions:	

PROJECT INFORMATION

Project ID:	E225-125		
Project Description:	CSULA - King Hall		
Project Zip Code:	90037	Sampling Date/Time:	4/28/25 0780
PO Number:		Sampled By:	Sergio Perez

TURN AROUND TIME CODES - (TAT)

STD - Standard (Default)
ND - Next Business Day
SD - Same Business Day
WH - Weekend/Holiday/ASAP

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

REQUESTED SERVICES

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
A-01	Field Blank				Do Not analyze blank
A-02	KH D2078	O	ND	1,287 liters	
A-03	KH D2078 E	O	ND	1,287 liters	
A-04	KH D2078 F	O	ND	1,287 liters	
					Do Not Analyze Field Blanks

Non-Culturable

Spore Trap Analysis	Other biological particles - supplement	Tape, Swab, Bulk: Direct Microscopic Exam (Qualitative)	Tape, Swab, Bulk: Quantitative spore count direct exam	Tape, Swab, Bulk: Dust Characterization

Culturable

BioCassette™ Andersen, SAS, Swab, Water, Bulk, Dust, Soil, Contact Plate: 1-Media Surface Fungi (Genus ID + *Asp.* spp.)	Culturable Air Fungi (Genus ID + *Asp.* spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteria)	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)

Other Requests

Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM	Lead (Pb) - Flame AA	PCR (please specify test)	Allergens (please specify test)
				Asbestos Air - TEM ✓✓✓

SAMPLE TYPE CODES

BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME
[signature]	4/28/25

RECEIVED BY	DATE & TIME
Alijah Navalta	to 04/28/25
am	1038

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/

Copyright © 2022 Eurofins EPK Built Environment Testing, LLC

eurofins | Built Environment Testing

Report for:

Mario Virgen
Global Environmental Training & Consulting, Inc.
1520 W. Cameron Ave
Suite 103
West Covina, CA 91790

Regarding: Eurofins Built Environment Testing West, LLC
Project: E225-125; CSULA - King Hall
EML ID: 4049202

Approved by:



Approved Signatory
Arthur Bucio

Dates of Analysis:
Asbestos TEM - AHERA (40CFR Part 763, Subpart E, Appendix A): 04-29-2025

Service SOPs: Asbestos TEM - AHERA (40CFR Part 763, Subpart E, Appendix A) (EM-AS-S-8578)
NVLAP Lab Code 200757-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. Due to the nature of the analyses performed, field blank correction of results is not applied. The results relate only to the samples as received and tested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Built Environment Testing West, LLC
2841 Dow Avenue, Suite 300, Tustin, CA 92780
(833) 465-5857 www.eurofinsus.com/Built

Client: Global Environmental Training & Consulting, Inc.
C/O: Mario Virgen
Re: E225-125; CSULA - King Hall

Date of Sampling: 04-28-2025
Date of Receipt: 04-28-2025
Date of Report: 04-29-2025

ASBESTOS TEM AHERA REPORT

Lab ID-Version‡ Location Analysis Date	Volume (liters)	Area Analyzed (mm2)	Grid Openings Examined	Analytical Sensitivity (S/cm3)	Non-Asbestos Count	Asbestos Types	Asbestos Structures (S)		§Asbestos Concentration	
							>= 5µm	>=0.5-<5µm	S/mm2	S/cm3
20177061-1 A-02 KH D2078 04/29/2025	1287	0.06	6	0.005	0	Chrysotile	0	1	16.502	0.005
Comments:										
20177062-1 A-03 KH D2078E 04/29/2025	1287	0.06	6	0.005	0	No Structures Detected	0	0	<16.502	<0.005
Comments:										
20177063-1 A-04 KH D2078F 04/29/2025	1287	0.06	6	0.005	0	No Structures Detected	0	0	<16.502	<0.005
Comments:										

§ Asbestos Concentration has been rounded to three significant figures to reflect analytical precision.

The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

Digital images of diffraction patterns and copies of analytical bench sheets pertaining to this project are available upon request. The estimated measurement of uncertainty and 95% confidence interval for the test results are also available upon request.

The laboratory is not responsible for data collected by personnel who are not part of the laboratory. Results reported in both structures/cm3 and structures/mm2 are dependent on the volume of air sampled and measured by non-laboratory personnel.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
2841 Dow Avenue, Suite 300, Tustin, CA 92780
(833) 465-5857 www.eurofinsus.com/Built


Client: Global Environmental Training & Consulting, Inc.
C/O: Mario Virgen
Re: E225-125; CSULA - King Hall

Date of Sampling: 04-28-2025
Date of Receipt: 04-28-2025
Date of Report: 04-29-2025

ASBESTOS TEM AHERA REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst




Analyst: Arthur Bucio

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

SCHEMATIC

Copyright © 2025 Global Environmental Training & Consulting, Inc. All Rights Reserved

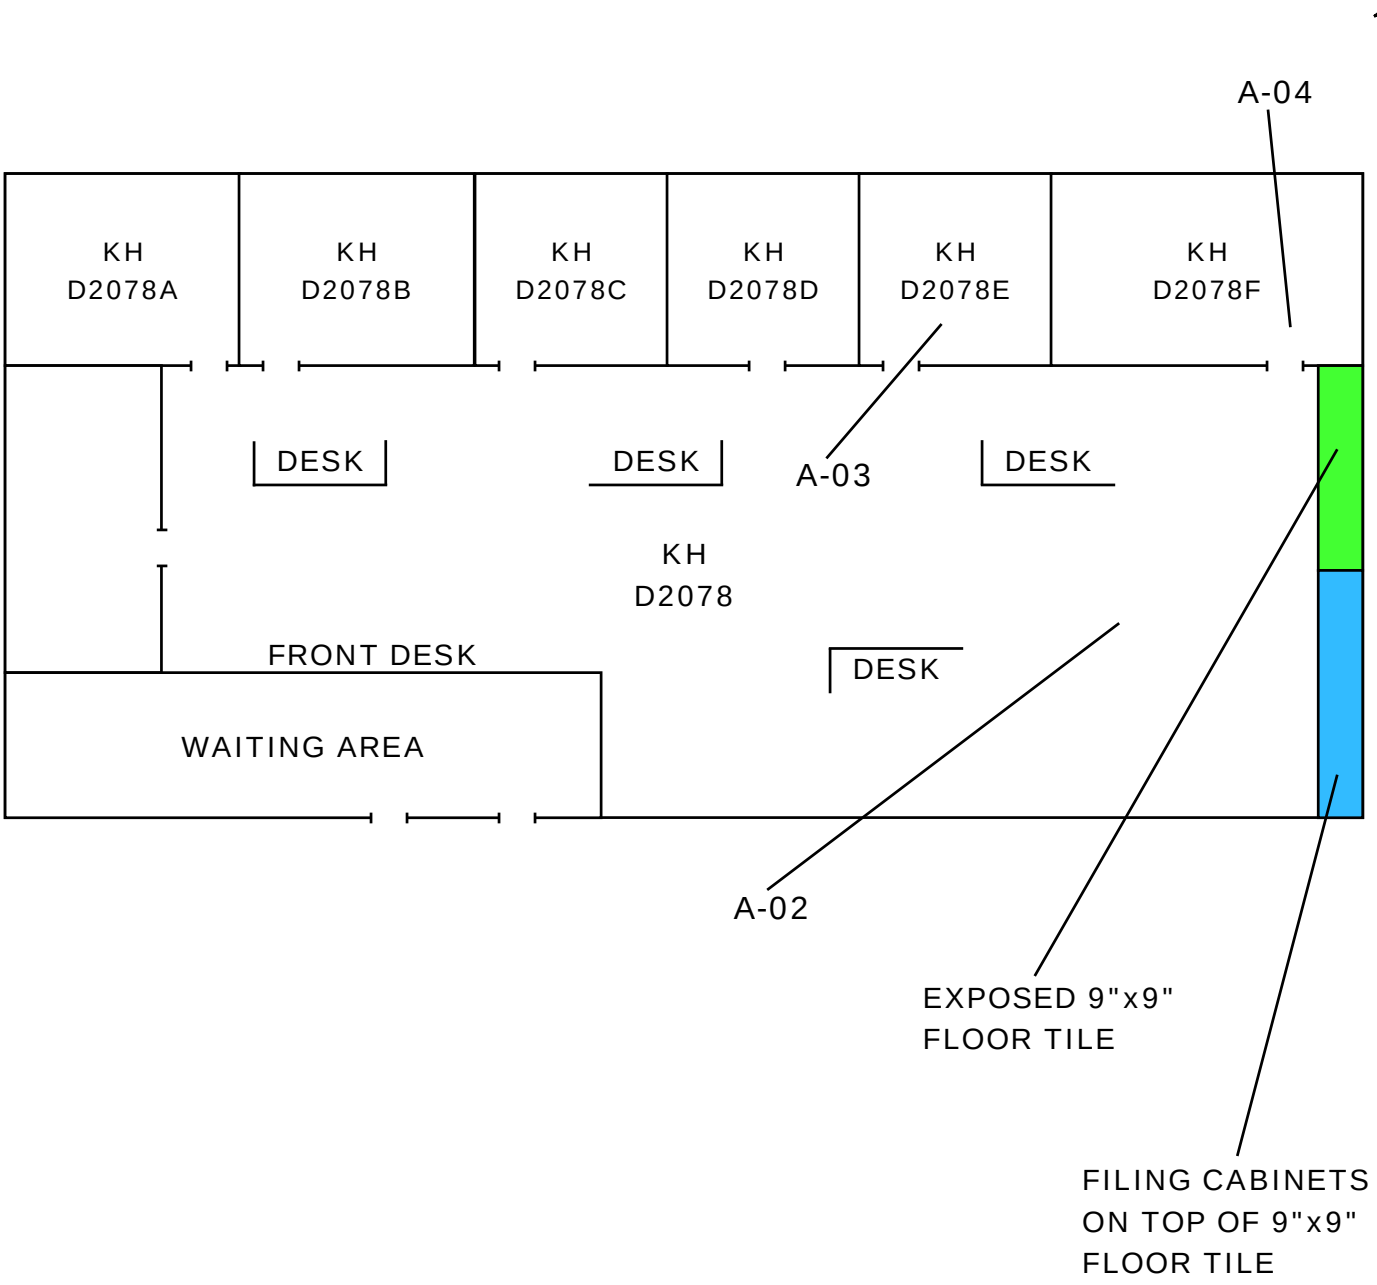

PROJECT NAME: CSULA - KING HALL - 2ND FLOOR

PROJECT NUMBER: E225-125

INSPECTOR'S CERTIFICATION

Copyright © 2025 Global Environmental Training & Consulting, Inc. All Rights Reserved

State of California
Division of Occupational Safety and Health
Certified Site Surveillance Technician

Sergio R Perez-Loa
Name



Certification No. **18-6224**

Expires on **05/15/25**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq. of the Business and Professions Code.

State of California
Division of Occupational Safety and Health
Certified Asbestos Consultant

Mario A Virgen
Name



Certification No. **00-2859**

Expires on **01/05/2026**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq of the Business and Professions Code.